



Preliminary Information

PIT5674B DTC C116C and/or C116B After Installation of GM Accessory Performance Brake Pads

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 1500 (New Model)	2019 - 2021	All	All	All	All
GMC	Sierra 1500 (New Model)	2019 - 2021	All	All	All	All

Involved Region or Country	North America
Condition	After installation of the GM Accessory Performance Brake Pads it may be noticed that the EBCM has set DTC(s) C116C sym05 and/or C116B sym05. There will be NO warning lights or messages displayed on the IPC/DIC.
Cause	The GM Accessory Performance Brake Pads do not utilize the brake pad wear sensor.

Correction:

None, the DTC(s) should be ignored. These DTC(s) do not cause any warning lights or messages to be displayed in the IPC/DIC. Per the GM Accessory Performance Brake installation instructions, the brake pad sensor connector should be capped with the supplied parts and the brake pad life system disabled in the DIC.

Note: The GM Accessory Performance brake pads still have built-in wear indicators that make a high-pitched warning sound when the brake pads are worn.

This PI will be deleted after the GM Accessory Performance Brake instructions are updated with this information.

Version History

Version	3
Modified	04/18/2019 - Created on 06/16/2020- Updated model years 04/12/2021 - Updated to add the 2021 models



GENERAL MOTORS